



HARTCROWSER

Earth and Environmental Technologies


Hart Crowser, Inc.
1910 Fairview Avenue East
Seattle, Washington 98102-3699
Fax 206.328.5581
Tel 206.324.9530
www.hartcrowser.com

J-2296-07

August 25, 1998

Mr. Gregory A. Rapp
Construction Services Manager
Potlatch Corporation
1100 Railroad Avenue
P.O. Box 386
St. Maries, Idaho 83861

Re: Second Quarter 1998 Performance Report
Avery Landing Recovery System

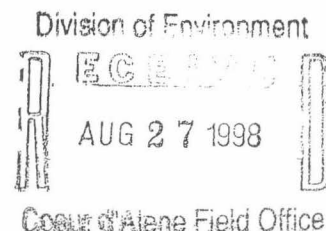

Dear Mr. Rapp:

Hart Crowser is pleased to present the Second Quarter 1998 Performance Report for the free product recovery system at the Avery Landing site. This letter report presents the second quarter groundwater elevation and product thickness measurements.

GROUNDWATER AND PRODUCT QUARTERLY MONITORING

Four extraction wells (EW-1 through EW-4), four monitoring wells (HC-1, HC-4, MW-5, and MW-11), and two piezometers (P-1 and P-2) were monitored on ~~August 12, 1998~~. We confirmed that well HC-5 was lost during road construction. There was no standing water in the vicinity of this former well location during the current monitoring event, which allowed us to confirm that it had been lost.

At each monitoring location, depth to groundwater measurements were recorded. The river elevation adjacent to each extraction well vault was also monitored by measuring the elevation difference between the top of the vault and the river. These measurements are presented with



those of previous monitoring rounds in Table 1. Well locations and current groundwater contours are shown on Figure 1. Depth to product and product thickness measurements were not collected due to equipment failure in the field.

Extraction wells EW-3 and EW-4 are maintaining groundwater capture. Extraction wells EW-1 and EW-2 have been shut down, as requested by the Idaho Department of Environmental Quality. By discontinuing pumping in EW-1 and EW-2, the ability to maintain groundwater capture in EW-3 and EW-4 has improved. It is too soon to tell whether EW-3 and EW-4 will maintain capture as the river level continues to fall.

PROJECT SCHEDULE

Table 2 presents the project schedule for the remainder of 1998. The third quarterly monitoring event listed corresponds to the third quarter of treatment system operation in 1998, which began in late spring. Since the system does not operate during the winter months, no well monitoring occurs. As indicated, we will submit an Annual Report for 1998 by February 1999. If you should decide that this date needs to be altered, please let us know as soon as possible.

**Table 2 - Avery Landing Recovery System
Remaining Project Schedule for 1998**

Remaining Schedule	Date
Conduct Third Quarter Monitoring	October 22, 1998
Submit Third Quarter Performance Report	November 13, 1998
Submit Annual Report	February 5, 1999

LIMITATIONS

Work for this project was performed, and this letter prepared, in accordance with generally accepted professional practices for the nature and conditions of the work completed in the same or similar location, at the time the work was performed. It is intended for the exclusive use of the Potlatch Corporation for specific application to the referenced property.



Potlatch Corporation
August 25, 1998

J-2296-07
Page 3

If additional information or clarification is required, please call Terry Montoya at (206) 324-9530.

Sincerely,

HART CROWSER, INC.

for TERRY MONTOYA
Project Manager

DAVID HEFFNER, P.E.
Associate Engineer

229607/Ptlc898.doc

Attachments:

Table 1 - Avery Landing Groundwater and River Monitoring Data
Figure 1 - Avery Landing Second Quarter Groundwater Flow Direction Map

cc: Kreg Beck, Idaho Department of Environmental Quality

Table 1 - Avery Landing Groundwater and River Monitoring Data

Monitoring Location	Date	Depth to Product	Depth to Water	Product Thickness	T.O.C. Elevation	Groundwater Elevation
EW-1	10/27/94	ND	11	0	95.34	84.34
	6/30/95	ND	10.9	0	95.34	84.44
	9/21/95	11.25	11.27	0.02	95.34	84.07
	7/11/96	ND	9.74	0	95.34	85.60
	9/11/96	ND	10.88	0	95.34	84.46
	11/5/96	ND	11.94	0	95.34	83.40
	7/17/97	ND	10.38	0	95.34	84.96
	10/9/97	ND	13.17	0	95.34	82.17
	6/25/98	ND	10.01	0	95.34	85.33
	8/12/98	NM	10.52	0	95.34	84.82
EW-2	10/27/94	ND	10.37	0	95.24	84.87
	6/30/95	10.57	10.89	0.32	95.24	84.35
	9/21/95	13.9	13.92	0.02	95.24	81.32
	7/11/96	11.03	11.66	0.63	95.24	83.58
	9/11/96	Sheen	14.00	0	95.24	81.24
	11/5/96	Sheen	12.27	0	95.24	82.97
	7/17/97	8.99	9.09	0.1	95.24	86.15
	10/9/97	Sheen	15.44	0	95.24	79.80
	6/25/98	9.19	9.64	0.45	95.24	85.60
	8/12/98	NM	9.99	0	95.24	85.25
EW-3	10/27/94	ND	10.05	0	95.78	85.73
	6/30/95	9.35	9.8	0.45	95.78	85.98
	9/21/95	10.92	11.08+	0.16	95.78	84.70
	7/11/96	8.53	8.64	0.11	95.78	87.14
	9/11/96	10.75	11.70	0.95	95.78	84.08
	11/5/96	Sheen	11.8	0	95.78	83.98
	7/17/97	9.13	9.33	0.2	95.78	86.45
	10/9/97	10.9	11.68	0.78	95.78	84.10
	6/25/98	8.78	9.43	0.65	95.78	86.35
	8/12/98	NM	11	0	95.78	84.78
EW-4	10/27/94	ND	8.05	0	94.32	86.27
	6/30/95	7.84	7.85	0.01	94.32	86.47
	9/21/95	8.22	8.24	0.02	94.32	86.08
	7/11/96	Sheen	6.44	0	94.32	87.88
	11/5/96	Sheen	8.08	0	94.32	86.24
	7/17/97	Sheen	5.43	0	94.32	88.89
	10/9/97	Sheen	7.11	0	94.32	87.21
	6/25/98	5.28	5.3	0.02	94.32	89.02
	8/12/98	NM	8.98	0	94.32	85.34

Table 1 - Avery Landing Groundwater and River Monitoring Data

Monitoring Location	Date	Depth to Product	Depth to Water	Product Thickness	T.O.C. Elevation	Groundwater Elevation
HC-1	10/27/94	ND	13.25	0	97.50	84.25
	6/30/95	ND	12.00	0	97.50	85.50
	9/21/95	NM	13.42	0	97.50	84.08
	7/11/96	ND	11.92	0	97.50	85.58
	9/11/96	ND	12.90	0	97.50	84.60
	11/5/96	Could not locate due to snow				
	7/17/97	ND	11.27	0	97.50	86.23
	10/9/97	ND	12.87	0	97.50	84.63
	6/25/98	ND	11.85	0	97.50	85.65
	8/12/98	NM	12.97	0	97.50	84.53
HC-4	10/27/94	13.3	15.34	2.04	98.94	83.60
	6/30/95	11.89	15.49	3.6	98.94	83.45
	9/21/95	13.67	NM	NM	98.94	85.27
	7/11/96	11.58	12.93	1.35	98.94	86.01
	9/11/96	13.53	13.93	0.40	98.94	85.01
	11/5/96	11.82	13.62	1.80	98.94	85.32
	7/17/97	11.65	13.25	1.60	98.94	85.69
	10/9/97	12.67	14.92	2.25	98.94	84.02
	6/25/98	11.53	12.49	0.96	98.94	86.45
	8/12/98	NM	13.9	0.00	98.94	85.04
HC-5	11/5/96	ND	11.22	0	97.95	86.73
	7/17/97	Monument under standing water				
	10/9/97	Monument under standing water				
	6/25/98	Well lost during road construction				
MW-4	9/14/94	ND	12.88	0	99.76	86.88
	6/30/95	ND	10.19	0	99.76	89.57
	9/21/95	ND	11.95	0	99.76	87.81
	7/11/96	Sheen	10.18	0	99.76	89.58
	9/11/96	Sheen	11.33	0	99.76	88.43
	11/5/96	Lost during road construction				
MW-5	10/27/94	ND	10.45	0	97.76	87.31
	6/30/95	ND	9.13	0	97.76	88.63
	9/21/95	ND	10.83	0	97.76	86.93
	7/11/96	ND	8.98	0	97.76	88.78
	9/11/96	ND	10.71	0	97.76	87.05
	11/5/96	ND	10.65	0	97.76	87.11
	7/17/97	ND	8.75	0	97.76	89.01
	10/9/97	ND	10.89	0	97.76	86.87
	6/25/98	ND	8.56	0	97.76	89.20
	8/12/98	NM	10.68	0	97.76	87.08

Table 1 - Avery Landing Groundwater and River Monitoring Data

Monitoring Location	Date	Depth to Product	Depth to Water	Product Thickness	T.O.C. Elevation	Groundwater Elevation
MW-11	9/14/94	12	NA	NA	98.16	NA
	6/30/95	5.54	7.25	1.71	98.16	90.41
	7/11/96	6.34	10.00	3.66	98.16	88.16
	9/11/96	3.25	7.20	3.95	98.16	90.96
	11/5/96	3.05	7.20	4.15	98.16	90.96
	7/17/97	6.33	9.99	3.66	98.16	88.17
	8/12/98	NM	3.90	0	98.16	94.26
P-1	10/27/94	ND	17.31	0	101.42	84.11
	6/30/95	ND	16.72	0	101.42	84.70
	9/21/95	ND	17.4	0	101.42	84.02
	7/11/96	ND	15.87	0	101.42	85.55
	9/11/96	ND	16.98	0	101.42	84.44
	11/5/96	ND	17.06	0	101.42	84.36
	7/17/97	ND	15.34	0	101.42	86.08
	10/9/97	ND	17.64	0	101.42	83.78
	6/25/98	ND	14.53	0	101.42	86.89
	8/12/98	NM	16.72	0	101.42	84.70
P-2	10/27/94	ND	15.87	0	100.06	84.19
	6/30/95	ND	15.26	0	100.06	84.80
	9/21/95	ND	16.04	0	100.06	84.02
	7/11/96	ND	14.52	0	100.06	85.54
	9/11/96	ND	15.62	0	100.06	84.44
	11/5/96	ND	15.08	0	100.06	84.98
	7/17/97	ND	13.92	0	100.06	86.14
	10/9/97	ND	16.09	0	100.06	83.97
	6/25/98	ND	15.95	0	100.06	84.11
	8/12/98	NM	15.3	0	100.06	84.76
River at EW-1	10/27/94					83.12 *
	6/30/95					84.03 **
	9/21/95					82.24
	7/11/96					83.74 ***
	9/11/96					82.56
	11/5/96					83.16
	7/17/97					82.39
	10/9/97					83.00
	6/25/98					85.22
	8/12/98					85.42

Table 1 - Avery Landing Groundwater and River Monitoring Data

Monitoring Location	Date	Depth to Product	Depth to Water	Product Thickness	T.O.C. Elevation	Groundwater Elevation
River at EW-2	10/27/94					84.41
	6/30/95					85.32
	9/21/95					83.53
	7/11/96					85.03
	9/11/96					83.85
	11/5/96					83.59
	7/17/97					85.35
	10/9/97					84.20
	6/25/98					86.42
	8/12/98					86.62
River at EW-3	10/27/94					85.16 *
	6/30/95					86.07
	9/21/95					84.28
	7/11/96					85.78 ***
	9/11/96					84.60
	11/5/96					84.10
	7/17/97					86.31
	10/9/97					85.16
	6/25/98					85.16
	6/25/98					85.65
River at EW-4	10/27/94					86.49 *
	6/30/95					87.40
	9/21/95					85.61
	7/11/96					87.11 ***
	9/11/96					85.93
	11/5/96					86.44
	7/17/97					87.27
	10/9/97					86.12
	6/25/98					88.34
	8/12/98					88.54

Notes:

All measurements in feet.

* River elevation was extrapolated from the river surface slope measured in 1995 and the river elevation measured south of EW-2 in 1994.

** River elevation was extrapolated from river surface slope, based on river elevations measured south of EW-2, EW-3, and EW-4 in 1995.

*** River elevation was extrapolated from river surface slope, and the wood dock benchmark.

T.O.C. - Top of Casing


ND - Not Detected

NA - Not Available

NM - Not Measured


229607/Ptlc898.XLS

Avery Landing Second Quarter Groundwater Flow Direction Map

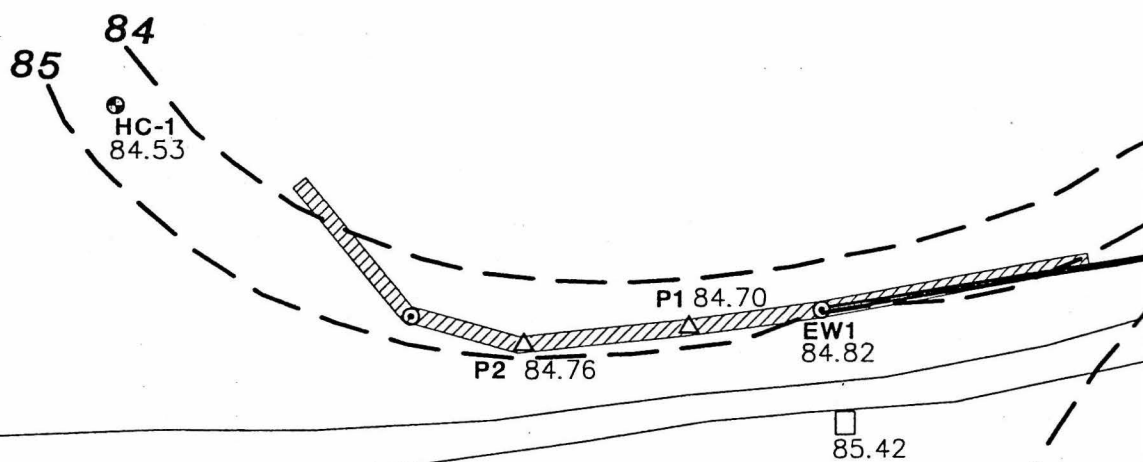

- MW-4 Monitoring Well Location and Number
- HC-5 Former Monitoring Well Location and Number
- 83.79 Groundwater Elevation in Feet (8/12/98)
- ⊙ EW1 Extraction Well Location and Number
- △ P1 Piezometer Location and Number



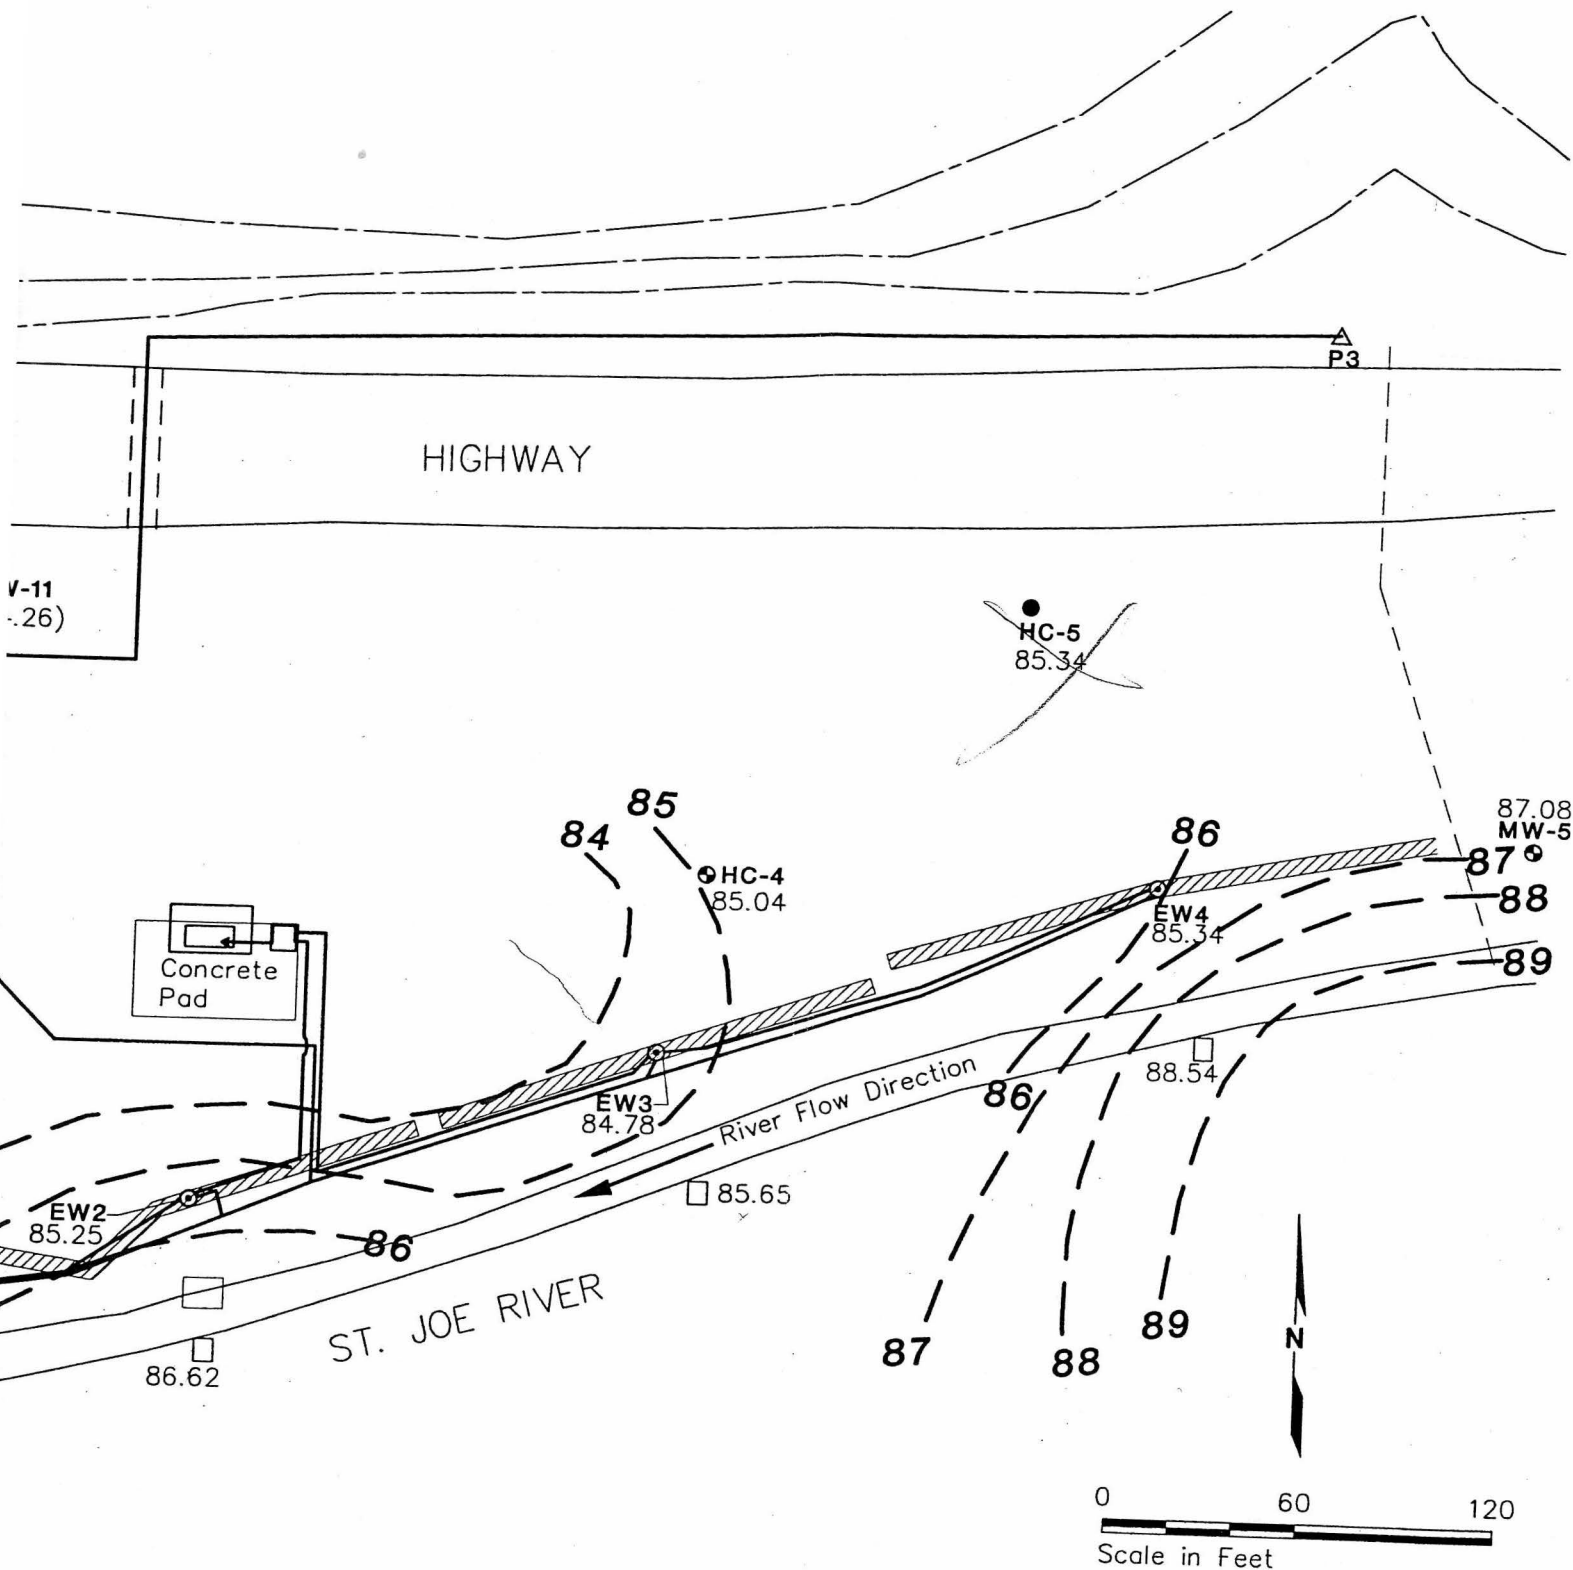

Estimated River Elevation in Feet (8/12/98)

Groundwater Elevation Contour in Feet

Approximate Groundwater Flow Direction

Extraction Trench

Note: Elevation datum is southwest corner of Concrete Pad (100.00 feet)

HARTCROWSER
J-2296-07 8/98
Figure 1